

# 7. Exploded View

UN36A (1Ø : 5, 7, 9kW) : ZHBW\*\*6A1.EWGBEEU


\* Service Bulletins (Deleted Part)

Service Bulletin No. DMZ202200153-01

1. Pump, Water : 158580 (MGQ62321902)
2. Harness, Multi : HNMW21 (EAD64827702)
3. Harness, Single : HNMW11 (EAD64827602)

\* Condenser Assembly Repaired Parts

| Description                       | Location No. | Quantity |
|-----------------------------------|--------------|----------|
| Condenser Assembly, Bending       | 554031       | 1        |
| Tube Assembly, Manifold (Outdoor) | 552115       | 1        |
| Tube Assembly, Condenser (Out)    | 552113       | 1        |
| Tube Assembly, Connector          | 352111A      | 1        |

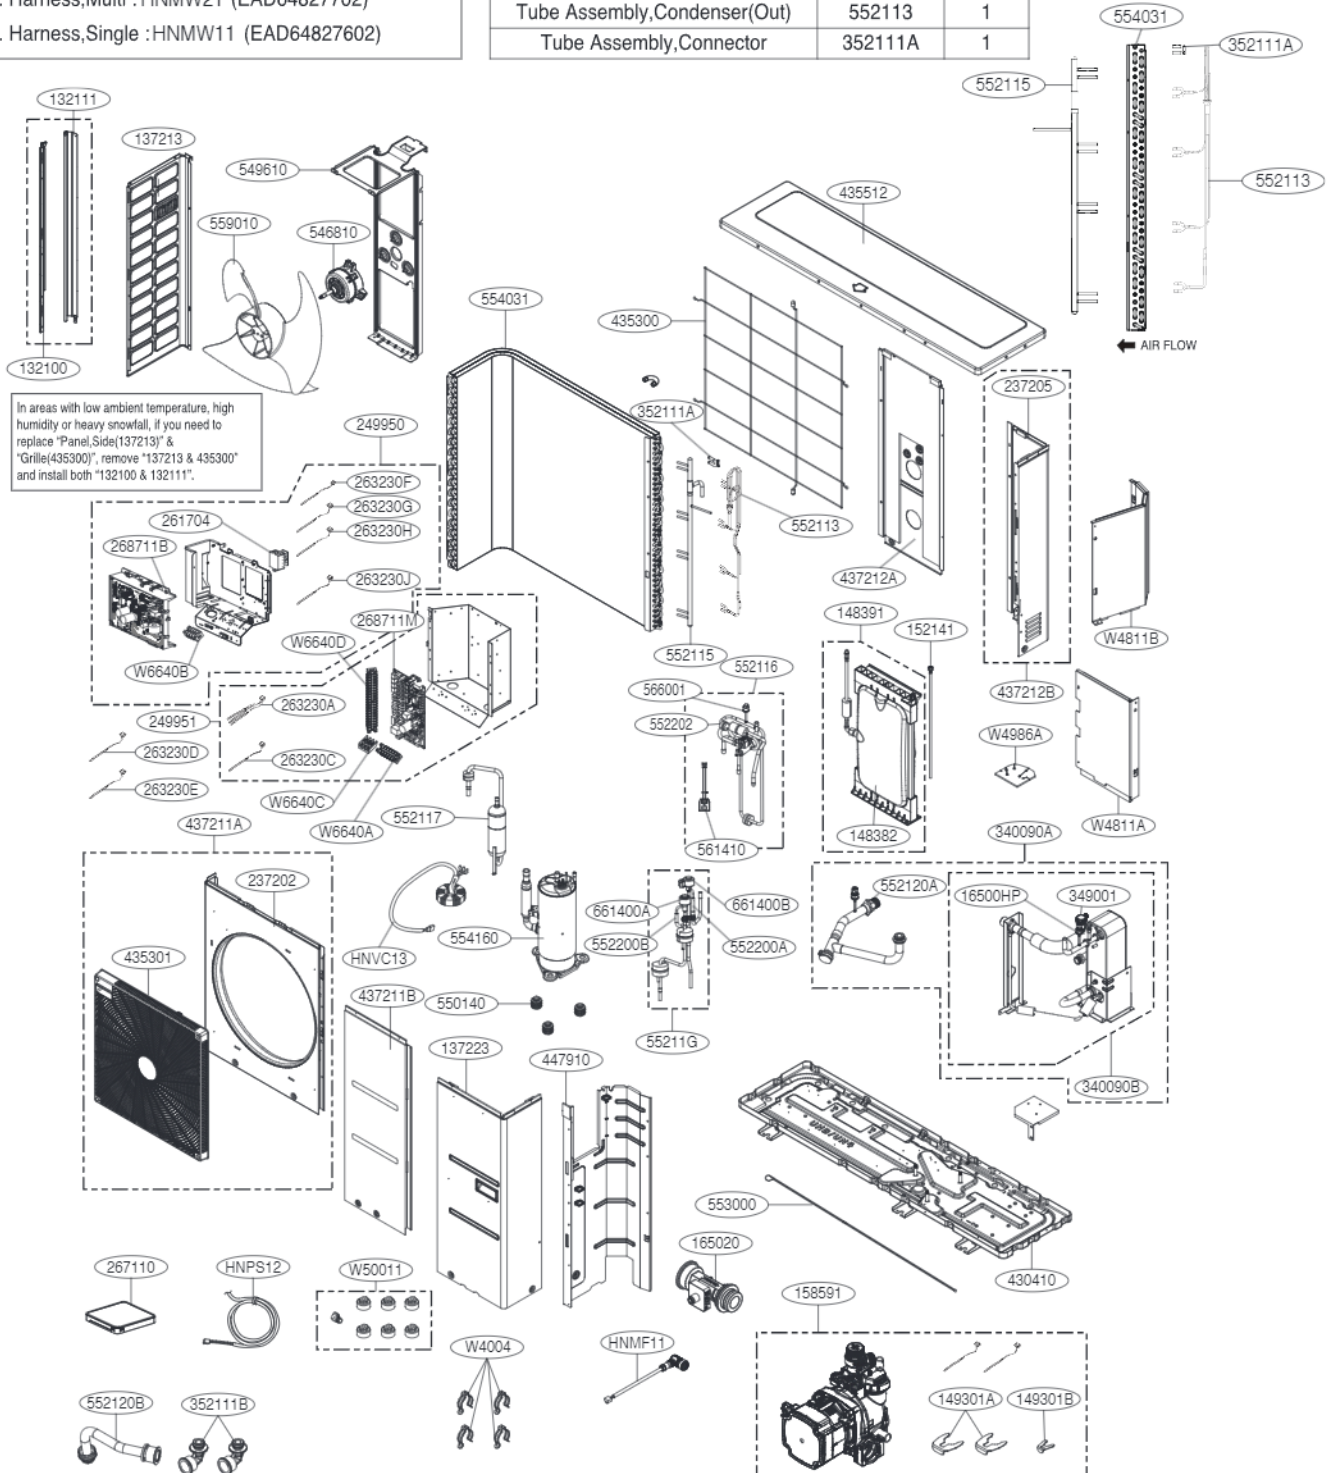

**Thermistor Assembly,NTC**

| Location No. | Thermistor Description        | Housing Color |
|--------------|-------------------------------|---------------|
| 263230A      | Water In/Water<br>Out/PHE Out | Black         |
| 263230C      | Pipe In                       | White         |
| 263230D      | SUCTION                       | Green         |
| 263230E      | DISCHA                        | Black         |
| 263230F      | AIR                           | Yellow        |
| 263230G      | MID-PIPE                      | Brown         |
| 263230H      | CONDENSER_PIPE                | Violet        |
| 263230J      | VI_IN                         | White         |