


6. Exploded View

Outdoor Unit

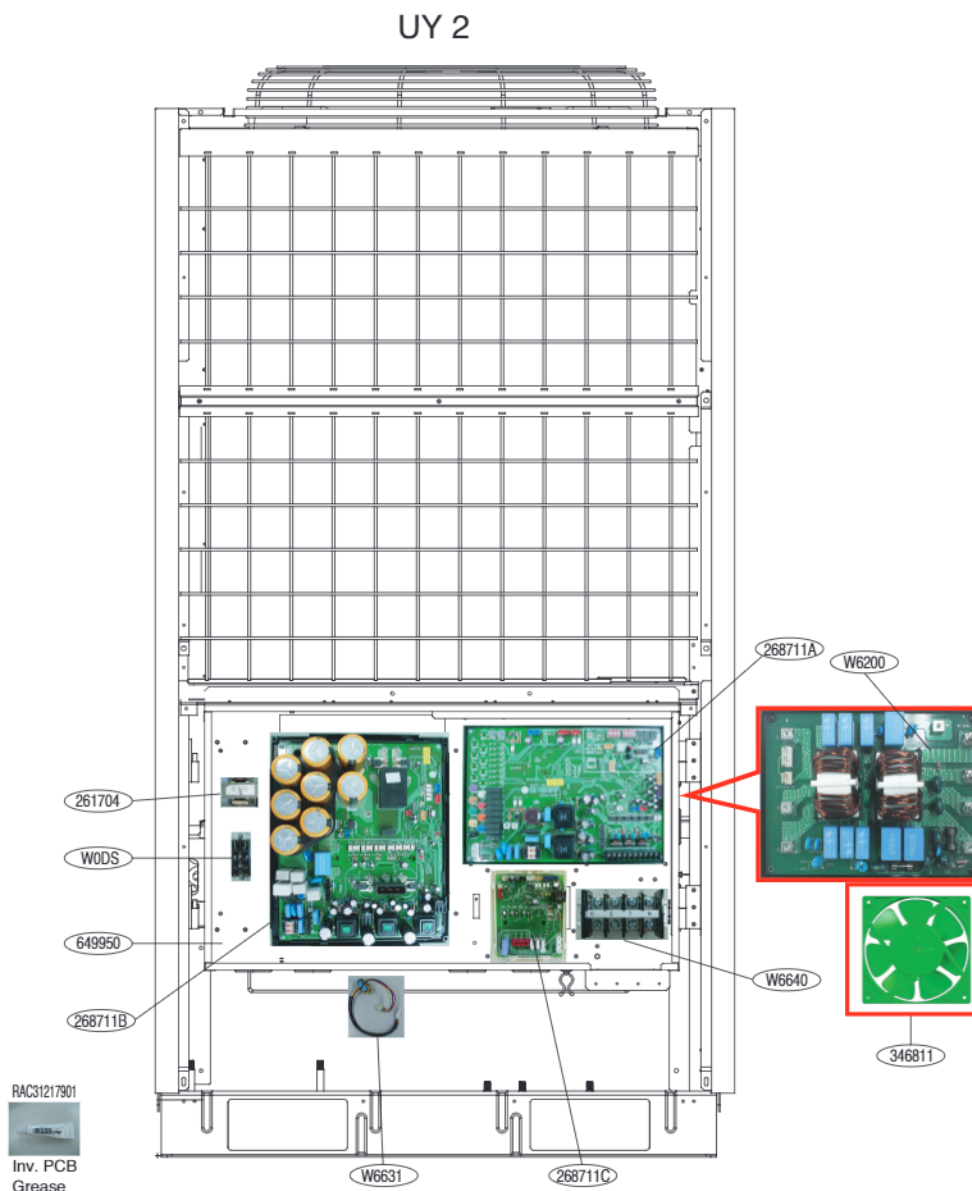

※ Before replacing INV control box or Fan motor PCB,
Please check Part Number.
There are two Part Number.

■ INV control box (Location Number : 649950)

Model	Panasonic Motor Model	LG Motor Model
ARUN60LT2	ABQ34827311	ABQ34827318
ARUN50LT2	ABQ34827312	ABQ34827319
ARUV80LT2	ABQ34827313	ABQ34827320
ARUV60LT2	ABQ34827314	ABQ34827321
ARUV50LT2	ABQ34827315	ABQ34827322

※ After May , 2010 , Multi V Plus II use LG motor (New).

■ Fan motor PCB (Location Number : 268711C)

Production Model	Panasonic Motor Model ~ 2010.4	LG Motor Model 2010.5 ~
ARUN60LT2	EBR39778503	EBR39778501
ARUN50LT2		
ARUV80LT2		
ARUV60LT2		
ARUV50LT2		



- * Before replacing fan motor, Please check fan motor maker.
- * Panasonic Motor (Part Number : EAU43475201) is the obsolete part. Please replace Panasonic Fan Motor with LG Fan Motor (Part Number : EAU36301603) and LG Fan Motor PCB.

Model	Classification	Description	Part Number	Location Number	Remark
ARUN50LT2(E)	Heating Only	Compressor	TBZ35436901	554160	Barrier Side
		Harness,Multi	EAD61072518	W6631	